QUALITY ASSURANCE REPORT/QUALITY CONTROL REPORT

AEE/QA/PR/05/2023-24, DATE: 31/01/2024		
Name of Work	:	Providing Infrastructure Programmes to SC/ST Communities in Dasarahalli Zone. Estimated cost 85.00 Lakhs
Job Code	:	014-22-000005
Bill No.& Amount	:	**1st& Final Bill.Rs.80,32,698.35 (Including GST)**
Name of Agency	:	**Sri. D Anand Naidu**
Type of Test Performed	:	Rebound Hammer test as per IS13311-(2)-1992, IS IS 516 (Part 5/Sec 1) 2018 for Ultrasonic Pulse Velocity
Materials on which Tests Was Performed	:	1.RCC Drain wall (M20) 2.Precast cover slab (M20)
Officers present during inspection	:	1. Sri Venkateshapp AEE-Dasarahalli Sub Division 2. Sri .D Sundaraiah AEE-Quality Assurance
Third Party Consultants	:	M/s Civil Aim Consultants & Engineers
Observations	:	➢ NDT (Rebound hammer test), Ultrasonic Pulse Velocity Test was conducted by Third Party Consultants representative at random locations in presence of AE(Dasarahalli Sub Division) along with AEE QA division. ➢ The Rebound Hammer Test & Ultrasonic Pulse Velocity Test was conducted randomly on RCC Drain wall (M20), Precast cover slab (M20). The readings and results are recorded by the Third Party Consultants. ➢ The readings of Rebound Hammer Test, Ultrasonic Pulse Velocity Test results are tabulated and analysis of test results done by Third Party Consultants is here by furnished. ➢ The location wise test results are reproduced in the tables shown below.
Test Locations	:	Location 1: Back Side of RO Plant, Manjunath Nagar Location 2 :Infront of Dharma Rama Temple, Manjunath Nagar

31/01/2024

ಸಹಾಯಕ ಕಾರ್ಯಪಾಲಕ ಅಭಿಯಂತರರು
ಗುಣಭರವಸೆ/ಗುಣನಿಯಂತ್ರಣ ಉಪ-ವಿಭಾಗ
ಬೃಹತ್ ಬೆಂಗಳೂರು ಮಹಾನಗರ ಪಾಲಿಕೆ

Table-01: Rebound Hammer Test Results

Sl. No.	Member	Rebound Hammer Number	Average reading	Compressive Strength (N/mm2)	Impact Direction
Location 1: Back Side of RO Plant, Manjunath Nagar					
1	RCC Drain Wall (M20)	28	28	20-22	Horizontal
2		30			
3		30			
4		28			
5		26			
6		28			
1	Precast Cover Slab (M20)	24	24	19-21	Vertical down
2		26			
3		24			
4		22			
5		24			
6		24			

Table-02: Rebound Hammer Test Results

Sl. No.	Member	Rebound Hammer Number	Average reading	Compressive Strength (N/mm2)	Impact Direction
Location 2 :Infront of Dharma Rama Temple, Manjunath Nagar					
1	RCC Drain Wall (M20)	30	29	21-23	Horizontal
2		28			
3		30			
4		30			
5		26			
6		28			

Table-03: Ultra Sonic Pulse Velocity Test Result

Sl. No.	Floor level / Structural Member/ Identification	Point of test	Path Length (mm)	Time Taken (μs)	Pulse Velocity (Km/Sec)	Mean Pulse Velocity (Km/Sec)	Concrete Quality Grading	Method of Transmission
Location 1: Back Side of RO Plant, Manjunath Nagar								
1	RCC Drain Wall (M20)	Random	100	24.5	4.08	4.04	Excellent	Indirect Method
			200	49.9	4.01			Indirect Method
Location 2 :Infront of Dharma Rama Temple, Manjunath Nagar								
2	RCC Drain Wall (M20)	Random	100	23.0	4.35	4.12	Good	Indirect Method
			200	51.5	3.88			Indirect Method

09/01/2024

ಸಹಾಯಕ ಕಾರ್ಯಪಾಲಕ ಅಭಿಯಂತರರು
ಗುಣಭರವಸೆ/ಗುಣನಿಯಂತ್ರಣ ಉಪ-ವಿಭಾಗ
ಬೃಹತ್ ಬೆಂಗಳೂರು ಮಹಾನಗರ ಪಾಲಿಕೆ

nclusion:

The file containing **1st & Final bill** has been submitted for the above work to QA department on 21.12.2023 requesting for spot inspection. Engineers of QA/QC division have visited the work spot on 21.12.2023

Third Party Consultants team was instructed to assess the strength of concrete used RCC Drain wall (M20), Precast cover slab (M20) by Rebound Hammer Test & Ultrasonic Pulse Velocity Test. The Rebound hammer test and Ultrasonic Pulse Velocity Test were conducted by Third Party Consultants in presence of engineer in charge of work.

From the test results furnished by Third Party Consultants, it is concluded that the results of the samplescollected are in accordance with the standards/ specifications mention in the IRC codes. However, the results submitted by the Third Party Consultants have been reproduced here with for further needful action. The results checked by QA/QC relates only for item tested in the particular location randomly.

Engineer in charge of work shall ensure that work executed as per this bill is not claimed in any other bill /work or else Engineer in charge of work shall be held responsible.

Further, QA/QC directs the Engineer in-charge of the work that all materials used for the work shall be inspected, tested and accepted as per the relevant specifications before incorporation in the work. The frequencies and methods of sampling and testing materials, including those required for definite purpose and not covered by MORT&H specifications shall be in accordance to the relevant IRC or BIS or AASHTO/ASTM/BS standards in order of priority.

All materials or work not conforming to the requirements of the specifications shall be considered unacceptable and rejected. The unacceptable materials or works that are rejected shall be immediately removed unless the defects are corrected and approved by the engineer in-charge of work.

The concerned Engineer in charge of the work shall follow the direction issued by Chief Commissioner Letter number dated 01.08.2022 and 14.09.2022 and take necessary action as appropriate in accordance with the law.

Note: -

This report by QA/QC is pertaining to the work carried out in **1st& Final bill** only.

Therefore, further QA/QC reports shall be obtained for the items of work carried out in future Running Account bill / Final bill.

Engineer in charge of work shall display details of work, work code, cost of project, start and completion date, and information of Engineer in charge of work with contact numbers at work spot.

Engineer in charge of work and Agency shall ensure that if any damages or defects occur pertaining to the executed work within the Defect Liability period (DLP), The same shall be rectified immediately on top priority without fail.

Engineer in charge of work shall ensure that any changes/ modification/change in location in the sanctioned estimate to be got approved by competent authority.

04/01/2024

ಸಹಾಯಕ ಕಾರ್ಯಪಾಲಕ ಅಭಿಯಂತರರು
ಗುಣಭರವಸೆ/ಗುಣನಿಯಂತ್ರಣ ಉಪ-ವಿಭಾಗ
ಬಿಬಿಎಂಪಿ ಬೆಂಗಳೂರು ಮಹಾನಗರ ಪಾಲಿಕೆ

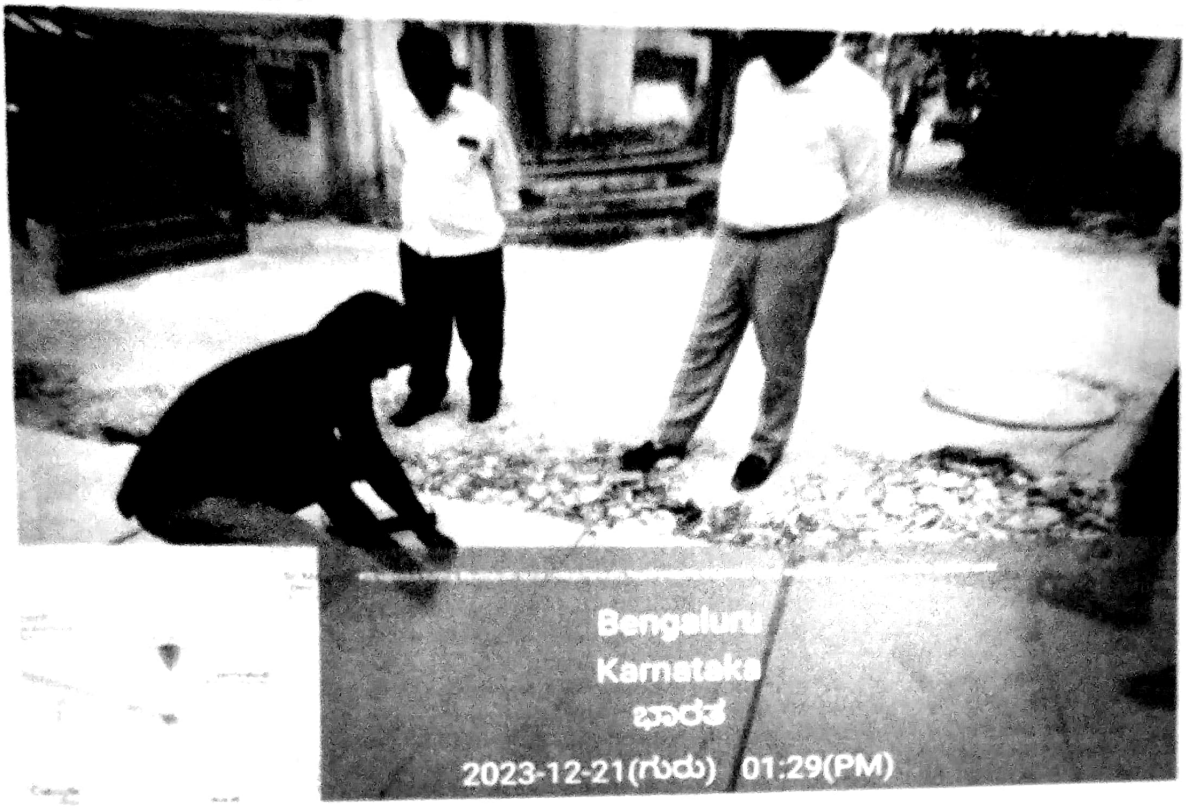

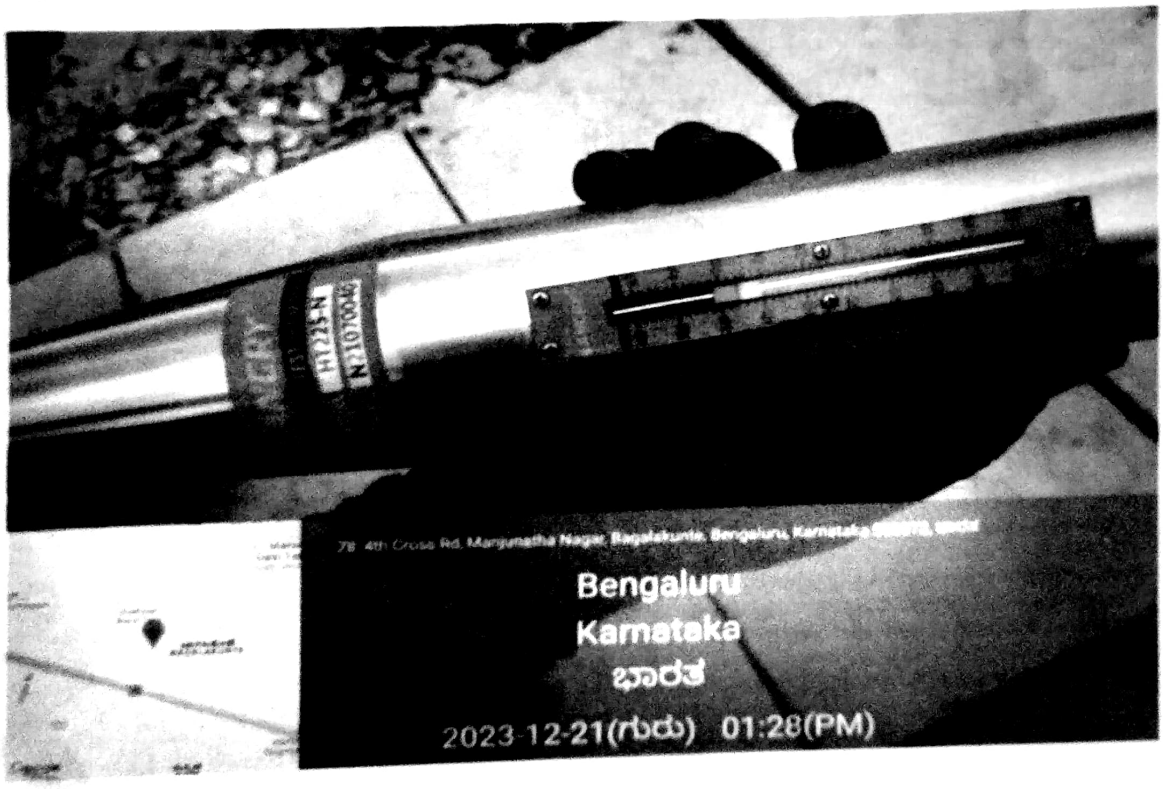

ಕಚೇರಿಯ ಕಾರ್ಯನಿರ್ವಾಹಕ ಅಭಿಯಂತರರು

Providing Infrastructure Programmes to SC/ST Communities in Dasarahalli Zone.

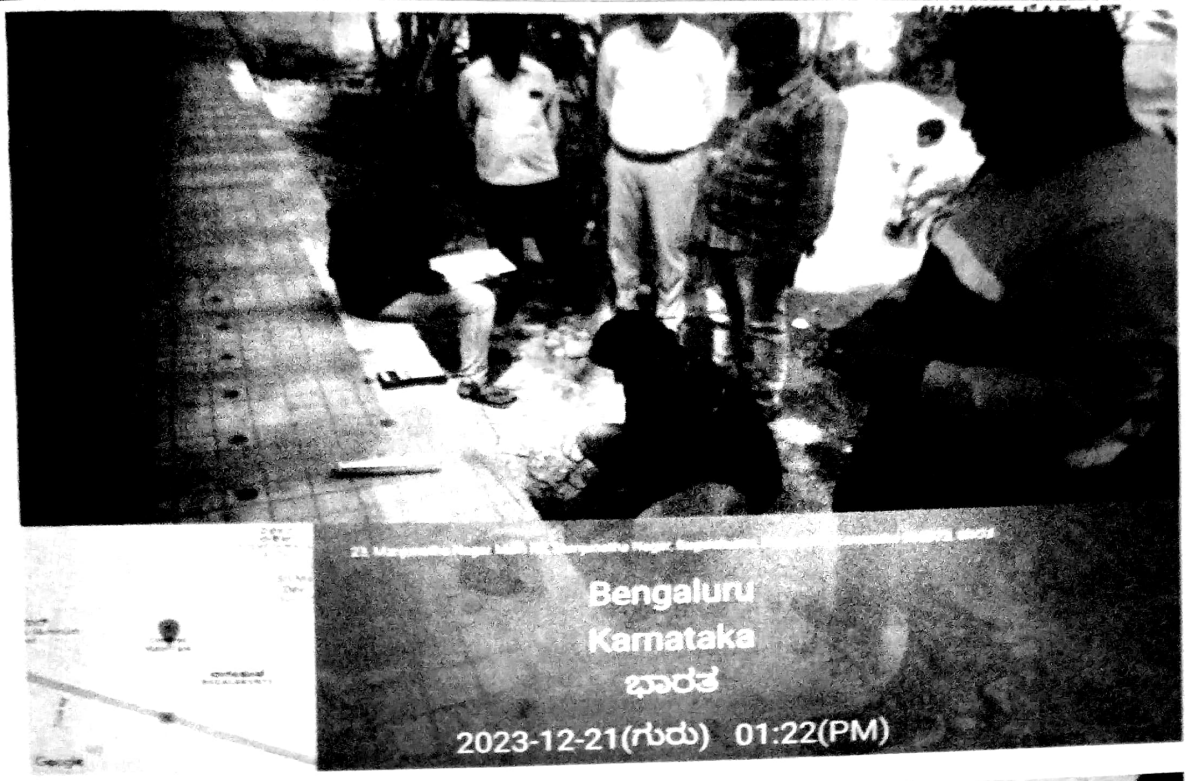

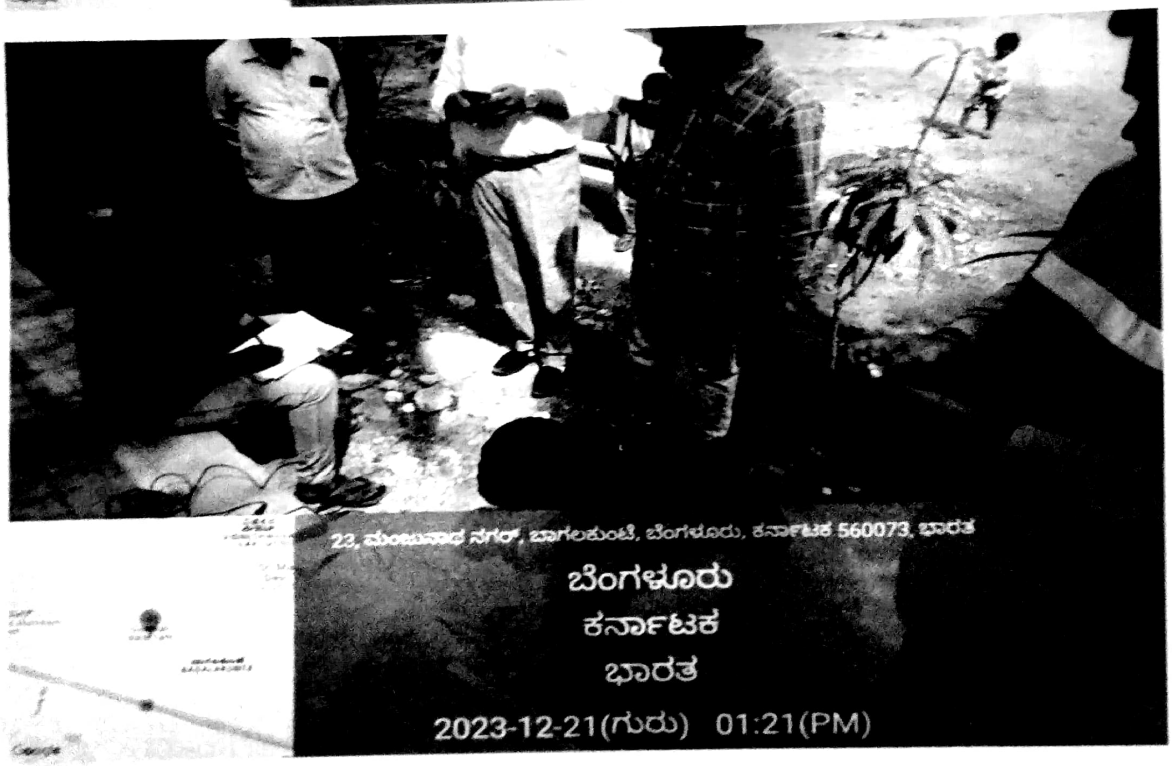

ಸಹಾಯಕ ಕಾರ್ಯಪಾಲಕ ಅಭಿಯಂತರರು
ಗುಣಭರವಸೆ/ಗುಣನಿಯಂತ್ರಣ ಉಪ-ವಿಭಾಗ
ಬೃಹತ್ ಬೆಂಗಳೂರು ಮಹಾನಗರ ಪಾಲಿಕೆ

Providing Infrastructure Programmes to SC/ST Communities in Dasarahalli Zone.

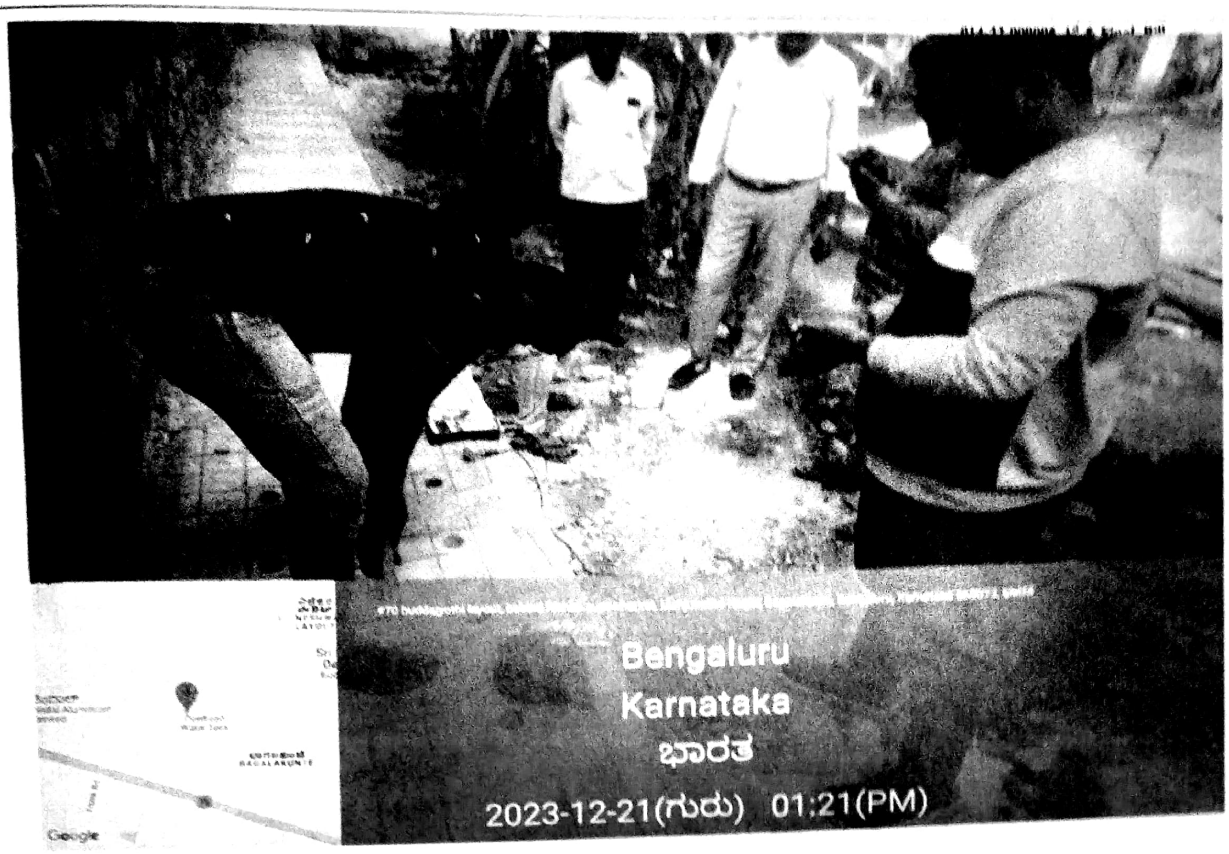

ಸಹಾಯಕ ಕಾರ್ಯಪಾಲಕ ಅಭಿಯಂತರರು
ಗುಣಧರಪಸೆ/ಗುಣನಿಯಂತ್ರಣ ಉಪ-ವಿಭಾಗ ೨
ಬೃಹತ್ ಬೆಂಗಳೂರು ಮಹಾನಗರ ಪಾಲಿಕೆ